

MODEL 950XLT2, 950XLT, 950XLTDA



Double Check – Backflow Preventers 3/4" to 2"

Repair Kit Components		3/4" and 1"					1-1/4" - 2"					2"
Item #	Item Description	RK34-950XL	RK34-950XLT	RK34-950XLR	RK34-950XLTSK	RK34-CK-COVER	RK114-950XL	RK114-950XLT	RK114-950XLR	RK114-950XLTSK	RK114-CK-COVER	RK2-950XLTDA
1	Check Cover					● (x2)					● (x2)	
2	O-Ring, Cover	● (x2)	● (x2)	● (x2)		● (x2)	● (x2)	● (x2)	● (x2)		● (x2)	● (x2)
3	Check Spring	● (x2)	● (x2)				● (x2)	● (x2)				● (x2)
4	Poppet		● (x2)					● (x2)				
5	Seal Ring	● (x2)	● (x2)	● (x2)			● (x2)	● (x2)	● (x2)			● (x2)
6	Seal Ring Retainer		● (x2)					● (x2)				
7	Retaining Bolt		● (x2)					● (x2)				
8	Check Seat		● (x2)		● (x2)			● (x2)		● (x2)		
9	O-Ring, Check Seat		● (x2)		● (x2)			● (x2)		● (x2)		

Whole Goods (Available for individual sale)							
Item #	Item Description	3/4"	1"	1-1/4"	1-1/2"	2"	
10	Ball Valve, Tapped 950XLT2	34-850TXL	1-850TXL	114-850TXL	112-850TXL	2-850TXL	
	Ball Valve, Tapped 950XLT	34-850T	1-850T	114-850T	112-850T	2-850T	
11	Ball Valve, 950XLT2	34-850XL	1-850XL	114-850XL	112-850XL	2-850XL	
	Ball Valve, 950XLT	34-850	1-850	114-850	112-850	2-850	
12	Butterfly Valve, Tapped*	N/A		114-49BRXLSST	112-49BRXLSST	2-49BRXLSST	
13	Butterfly Valve*			114-49BRXLSS	112-49BRXLSS	2-49BRXLSS	
14	Gate Valve			114-48OSY	112-48OSY	2-48OSY	
15	Test Cock	18-860XL		14-860XL			
16	Test Cock Cap Plug	2-7P					
17	Water Meter 5/8"	557-54XL					
	Check Seat Tool (x6)	BRK34-SEATTOOL			BRK114-SEATTOOL		

*Integral Supervisory Switch Option Available

Model 350D Bypass		
Item #	Kit #	Item Description
18	RK34-350D	Complete Bypass Repair Kit, 3/4" 350D
	RK34-350DV	Vessel Repair Kit, 3/4" 350D


Item No.	Repair Kit Description
3/4" and 1"	
RK34-950XL	Rubber and Spring Repair Kit, 3/4" and 1" 950XLT2 and 950XLT
RK34-950XLT	Complete Repair Kit, 3/4" and 1" 950XLT2 and 950XLT
RK34-950XLR	Rubber Repair Kit, 3/4" and 1" 950XLT2 and 950XLT
RK34-950XLTSK	Seat Repair Kit, 3/4" and 1" 950XLT2 and 950XLT
RK34-CK-COVER	Repair Kit, Check Cover 3/4" and 1" 950XLT2 and 950XLT
BRK34-SEATTOOL	Seat Removal Tool Bulk Repair Kit, 3/4" and 1" 950XLT2 and 950XLT

Item No.	Repair Kit Description
1-1/4" - 2"	
RK114-950XL	Rubber and Spring Repair Kit, 1-1/4" - 2" 950XLT2, 950XLT, and 2" 950XLTDA
RK114-950XLT	Complete Repair Kit, 1-1/4" - 2" 950XLT2, 950XLT, and 2" 950XLTDA
RK114-950XLR	Rubber Repair Kit, 1-1/4" - 2" 950XLT2, 950XLT, and 2" 950XLTDA
RK114-950XLTSK	Seat Repair Kit, 1-1/4" - 2" 950XLT2, 950XLT, and 2" 950XLTDA
RK114-CK-COVER	Repair Kit, Check Cover 1-1/4" - 2" 950XLT2, 950XLT, and 2" 950XLTDA
RK2-950XLTDA	Spring Repair Kit, 2" 950XLTDA
BRK114-SEATTOOL	Seat Removal Tool Bulk Repair Kit, 1-1/4" - 2" 950XLT2, 950XLT and 2" 950XLTDA


MODEL 950XLT2, 950XLT, 950XLTD

Double Check – Backflow Preventers 3/4" to 2"


Parts Drawing

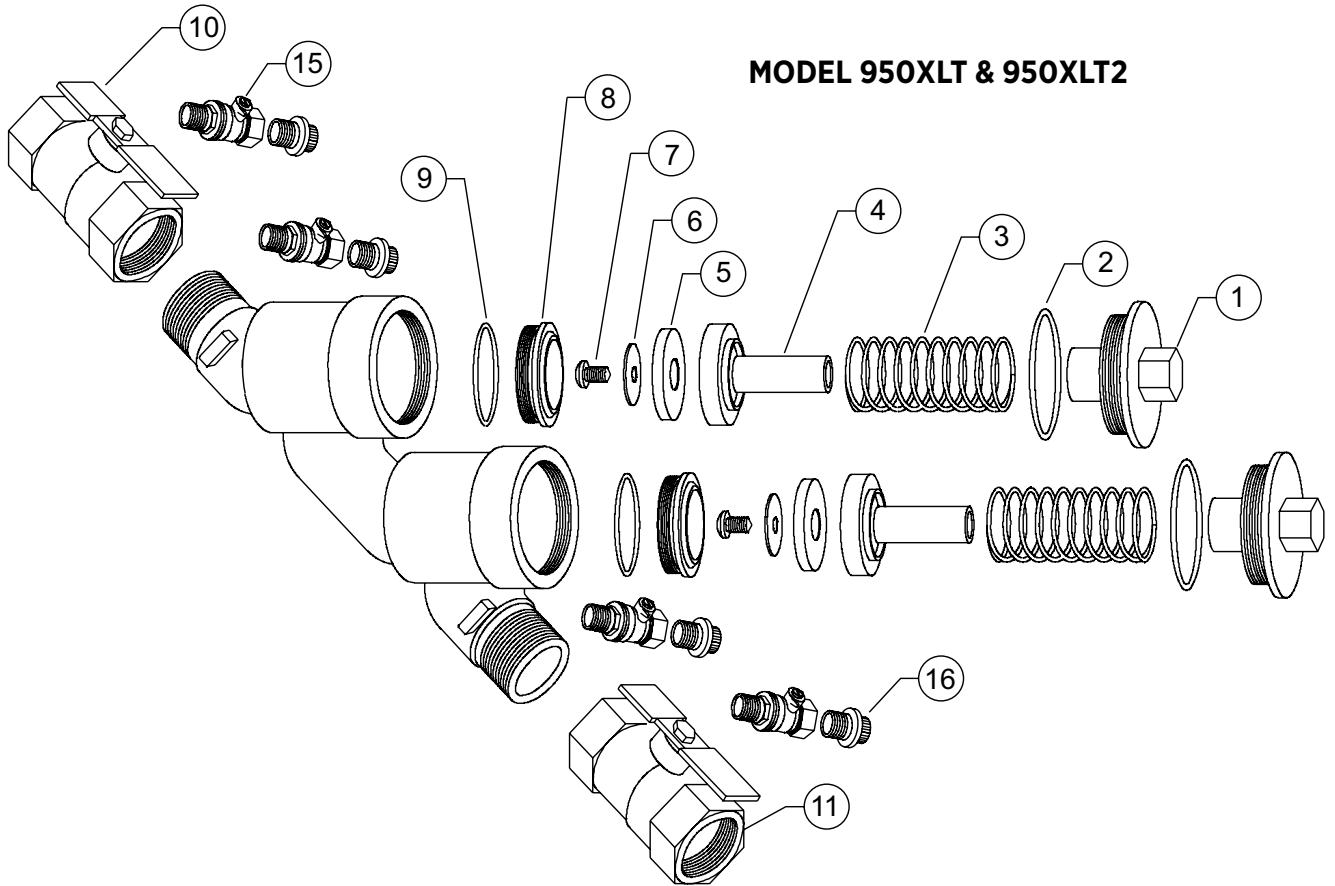

MODEL 950XLT & 950XLT2

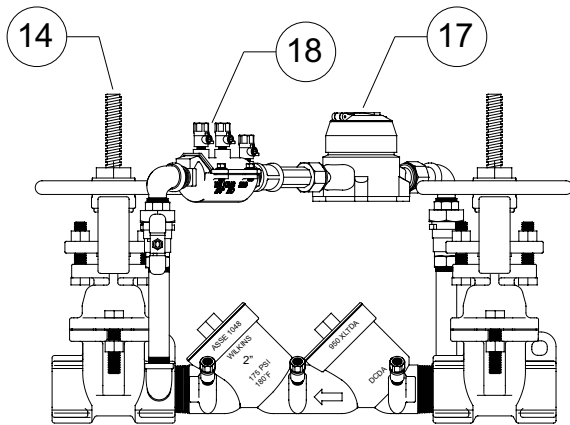

MODEL 950XLTD

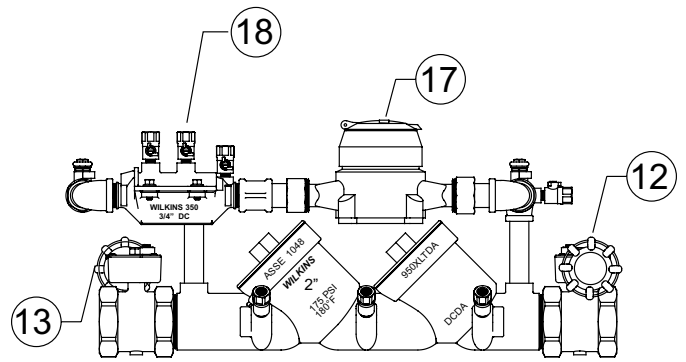

MODEL 950XLTDABF



36 Hudson Rd
Sudbury MA 01776



800-225-4616
www.tisales.com